


Contact: Carl Davis
200 Jetport Rd.
Brandon, MS 39047
Phone: 601-936-0777

Honeywell | Aerospace
THE POWER OF CONNECTED

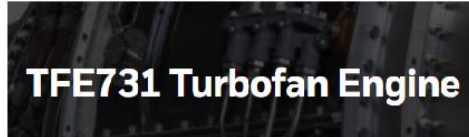

**TFE731-3-1C 3072800-2/
P76133**

TTSN	9,611.6	TS FAN SUPPORT	1,223.4
TCSN	7,509	CS FAN SUPPORT	1,257
TSMPI	1,223.4	PLENUM	1,223.4
CSMPI	1,257	ASSY GEARBOX	1,223.4

PART NAME	PART #	SERIAL #	TOTAL CYC	CYC LIMIT	CYC REMAIN
FAN ROTOR DISC	3073563-2	960322902325	5,090	10,000	4,910
1 ST LPC DISC	3072395	8-12112-1240	2,880	10,000	7,120
2 ND LPC DISC	3072396	7-12112-3622	2,880	10,000	7,120
3 RD LPC DISC	3072397	8-12112-1772	2,880	10,000	7,120
4 TH LPC DISC	3072398	7-12112-2821	2,880	10,000	7,120
HP COMPRESSOR	3073394-1	0-23365-1129	5,714	10,000	4,286
HP SHOULDERED SHAFT	3072545	9P5318	1,990	12,000	10,010
HPT ROTOR SEAL PLATE	3072411-1	8-18040-2879	1,990	10,000	8,010
HP TURBINE	3072316	9-12112-2092	4,666	7,000	2,334
1 ST LPT DISC	3075830-1	070322902205	1,257	3,000	1,743
2 ND LPT DISC	3072542-5	010322900369	2,949	3,000	51
3 RD LPT DISC	3074096-2	021217200167	1,573	7,000	5,427

ADDITIONAL INFO:

- Last MPI – BIZJET 10 AUG 2009
- Last PLENUM – BIZJET 10 AUG 2009
- Last FAN SUPPORT – BIZJET 10 AUG 2009
- Non-incident
- Performance Run prior to removal completed, results available on request

Disclaimer: Verification of the above provided information shall be the sole responsibility of the buyer/installer. Davis Aviation, Inc. is not responsible and accepts no liability for the use of this information, or for any consequences of any actions taken, or any loss or damage caused, or alleged to have been caused directly, or indirectly on the basis of the information provided above.